

UNCLASSIFIED

|                                                                                                                                                                                                      |              |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------|
| AD NUMBER                                                                                                                                                                                            |              |
| AD016427                                                                                                                                                                                             |              |
| CLASSIFICATION CHANGES                                                                                                                                                                               |              |
| TO:                                                                                                                                                                                                  | unclassified |
| FROM:                                                                                                                                                                                                | confidential |
| LIMITATION CHANGES                                                                                                                                                                                   |              |
| TO:<br>Approved for public release; distribution is unlimited.                                                                                                                                       |              |
| FROM:<br>Distribution authorized to U.S. Gov't. agencies and their contractors;<br>Administrative/Operational Use; SEP 1952. Other requests shall be referred to Naval Proving Ground, Dahlgren, VA. |              |
| AUTHORITY                                                                                                                                                                                            |              |
| 30 Sep 1974, DoDD 5200.10; USNSWC ltr, 18 Nov 1975                                                                                                                                                   |              |

THIS PAGE IS UNCLASSIFIED

CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

-----

PART A

SYNOPSIS

1. a. The Magnavox Company, Fort Wayne, Indiana, is currently working on the development of the T-2025 nose fuze for use with the 2"75 High Explosive, Folding Fin Aircraft Rocket.

b. Previous tests conducted on this fuze at other activities reported that this fuze has functioned on 0"032 and 0"500 thick aluminum targets at striking velocities of approximately 980 ft. per sec. The fuze functioning times obtained were approximately 500 to 600 microseconds.

2. The object of this test was to determine the impact sensitivity and functioning delay of the T-2025 fuze, rocket fired at higher velocities against thin aluminum targets.

3. The following conclusions are based upon the limited number of rounds fired during this test.

a. The T-2025 fuzes tested were not sensitive enough to function on less than 1/4" thick 24ST aluminum targets set at 0° obliquity at velocities of 2000 ft/sec.

b. One of three rounds fired at 0"250 thick 24ST aluminum targets set at 0° obliquity detonated high order. The delay was less than 6 inches. Average rocket striking velocities were 1800 ft/sec.

c. Two of 4 rounds fired at 0"500 thick 24ST aluminum plate set 0° obliquity detonated high order; one with a delay of less than 6 inches and the other less than 2 ft. Average rocket striking velocities were 1800 ft/sec.

CONFIDENTIAL  
SECURITY INFORMATION

CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

TABLE OF CONTENTS

|                                          | <u>Page</u>         |
|------------------------------------------|---------------------|
| SYNOPSIS . . . . .                       | 1                   |
| TABLE OF CONTENTS. . . . .               | 2                   |
| AUTHORITY. . . . .                       | 3                   |
| REFERENCES . . . . .                     | 3                   |
| BACKGROUND . . . . .                     | 3                   |
| OBJECT OF TEST . . . . .                 | 3                   |
| PERIOD OF TEST . . . . .                 | 3                   |
| REPRESENTATIVES PRESENT. . . . .         | 3                   |
| DESCRIPTION OF ITEM UNDER TEST . . . . . | 4                   |
| DESCRIPTION OF TEST EQUIPMENT. . . . .   | 4                   |
| PROCEDURE. . . . .                       | 5                   |
| RESULTS AND DISCUSSIONS. . . . .         | 5                   |
| CONCLUSIONS. . . . .                     | 7                   |
| APPENDIX A - TEST RESULTS. . . . .       | TABLE I 1 (Only)    |
| APPENDIX B - NPG PHOTOGRAPHS . . . . .   | FIGURES 1-15 (Incl) |
| APPENDIX C - DISTRIBUTION. . . . .       | 1-2 (Incl)          |

CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

PART B

INTRODUCTION

1. AUTHORITY:

This test was conducted in accordance with enclosure (1) of reference (b) as authorized by reference (a).

2. REFERENCES:

- a. NAVPROV Telcon OPG:RLH:ach L1-2 of 9 April 1952
- b. OCO ltr: ORDTA O.O 471.82/1027 (c) 26 March 1952

3. BACKGROUND:

a. The Magnavox Company, Fort Wayne, Indiana, is currently working on the development of the T-2025 nose fuze for use with the 2.75 High Explosive, Folding Fin Aircraft Rocket.

b. Previous tests conducted on this fuze at other activities reported that this fuze has functioned on 0.032 and 0.500 thick aluminum targets at striking velocities of approximately 980 ft. per sec. The fuze functioning times obtained at one activity were approximately 500 to 600 microseconds.

4. OBJECT OF TEST:

The object of this test was to determine the sensitivity and functioning delay of the T-2025 Fuze, rocket fired at high velocities, after impact with light aluminum armor.

5. PERIOD OF TEST:

- |                                     |             |
|-------------------------------------|-------------|
| a. Date Project Letter              | 15 Apr 1952 |
| b. Date Necessary Material Received | 5 Apr 1952  |
| c. Date Commenced Test              | 16 Apr 1952 |
| d. Test Completed                   | 18 Apr 1952 |

6. REPRESENTATIVES PRESENT:

|                   |                             |
|-------------------|-----------------------------|
| Mr. A. Nunes-Vais | Picatinny Arsenal           |
| Mr. Chester Piper | Magnavox Corp.              |
| Mr. J. C. Koonz   | Magnavox Corp.              |
| Mr. James Kistle  | Office of Chief of Ordnance |

CONFIDENTIAL  
SECURITY INFORMATION

CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

-----

PART C

DETAILS OF TEST

7. DESCRIPTION OF ITEM UNDER TEST:

a. The T-2025 is a point detonating rocket fuze being developed for use with the 2475 High Explosive, Folding Fin Aircraft Rocket. It is an electric type fuze having its electric power supplied by a small built-in generator. Figure 1 is a drawing of the fuze. The generator consists of a coil and a permanent magnet plunger held under spring tension at the entrance of the coil. The spring loaded plunger is triggered on target impact by a steel ball, which breaks the plunger at its restricted section allowing the plunger to be driven into the coil. When the magnetic plunger is driven into the coil an electromotive force of short duration is induced. This electromotive force reaches a peak of 100 volts which fires the electric primer connected in series with it.

b. The fuze safety features and arming mechanism were modified from that shown in Figure 1 to that shown in Figure 2 for these tests. This modification allowed the fuze to be armed prior to firing by withdrawing the arming wire. This eliminated the possibility of fuze arming failures occurring due to vibrations developed during passage of the rocket through the launcher rails.

c. Figure 3 is a photograph of the experimental rocket before and after assembly, as used in this test.

8. DESCRIPTION OF TEST EQUIPMENT:

- |                                   |                                                                             |
|-----------------------------------|-----------------------------------------------------------------------------|
| a. Rocket Motors                  | 5"0 Rocket Motor Mk 2 Mod 3<br>5"0 Rocket Motor Model 38<br>(White Whizzor) |
| b. Rocket Adapters                | 5"0 to 2475 head-to-motor<br>adapter (steel) PX-8-539A                      |
| c. Launcher                       | NPG 1050 ft.                                                                |
| d. Cameras                        | One Bowen<br>One 16mm High Speed Eastman                                    |
| e. Velocity Recording Instruments | Oscillograph and Counter-<br>Chronograph                                    |

CONFIDENTIAL  
SECURITY INFORMATION

CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

9. PROCEDURE:

Three rounds with a black powder, smoke puff indicator were fired prior to the firing of full explosive loaded rounds. These were to determine whether launcher vibrations would cause the fuze to function while being projected down the track. They were fired as a precautionary measure, taken for the prevention of damage to the launcher.

The first two rounds fired had one 5" HVAR motor as a booster and a 5"O "White Whizzer" Model 38 as the head motor. The head motor was ignited after 200 ft. of travel. Maximum striking velocity obtained by this test procedure was 2075 ft./sec. A study of the film record indicated that the head motors were not completely burnt out at the target. Therefore the booster motors on the following rounds were eliminated.

The Bowon Camera covered the target and approximately 500 ft. of rocket flight. The 16mm Eastman Camera also recorded the target area.

10. RESULTS AND DISCUSSION:

a. Details of test results are found in Table I.

b. Summarized test results are as follows:

| No.<br>of<br>Rds. | Target-24ST<br>Aluminum | Obliquity | Striking<br>Velocity<br>(ft/sec.) | Functioning<br>High Order | Dud |
|-------------------|-------------------------|-----------|-----------------------------------|---------------------------|-----|
| 1                 | 0°032                   | 0°        | 2075                              | --                        | 1   |
| 1                 | 0°064                   | 0°        | 2169                              | --                        | 1   |
| 1                 | 0°064                   | 45°       | 1976                              | --                        | 1   |
| 1                 | 0°125                   | 0°        | Est. 2200                         | --                        | 1   |
| 3                 | 0°250                   | 0°        | Approx. Av. 1800                  | 1                         | 2   |
| 4                 | 0°50                    | 0°        | Approx. Av. 1800                  | 2*                        | 2   |

\* One round token loaded  
One round High Explosive Loaded

c. Delays in explosive functioning of the High Explosive Loaded rounds were estimated to be less than 6 inches. Figures 7 and 11 show target penetration and High Order explosive action of rounds 5 and 9 respectively. Figure 12 shows the results of the impact of round 9 on 1/2" 24ST aluminum. Fragmentation marks of High Order detonation can be seen on the face of the target substantiating

CONFIDENTIAL  
SECURITY INFORMATION

Functioning Test of P.D. Rocket Fuze T-2025  
-----

the estimated delay of this round to be less than 6 inches. Figures 5, 6, 8, 9, 10, 13, and 14 are photographic records of target impacts for rounds 2, 3, 6, 7, 8, 10, and 11 which were all duds. The explosive actions seen in these records were not caused by rocket head detonation but includes a plate flash and burning of aluminum dust resulting from the heat generated during penetration.

d. One High Order detonation occurred during the firing of the three token loaded rounds. Figure 4 shows target impact and detonation action of this round. The delay of this round could not be accurately measured but was estimated to be not greater than 24 inches.

e. The following analysis of the above results are based entirely on the assumption that a sufficient electric charge is consistently generated by the T-2025 fuze during normal operating procedure.

(1) Four rounds were fired at 24ST aluminum targets less than 1/4" thick and were all duds. This may indicate that the energy imparted to the steel ball on target impact was not sufficient to rupture the steel plunger at its restricted section.

(2) Four of the seven rounds fired at 24ST aluminum targets 1/4" thick and 1/2" thick were duds. These duds may be attributed to the disarrangement of fuze components limiting the freedom of plunger motion, resulting from the added severeness of target impact.

(3) Figure 15 shows the recovered, unexploded 2"75 rocket head, with the T-2025 fuze fired as round 10. It had penetrated one-half inch thick 24ST aluminum plate set at 0° obliquity at a striking velocity estimated as 1900 ft/sec. It appeared that the flat steel nose section of the fuze housing had been driven back into the cylindrical void in which the steel ball bearing and plunger head are located. Army representatives present advised that drop tests of other T-2025 fuzes had produced similar damage. Fuzes subjected to the drop tests had the sleeve assembly and coil bushing assembly (shown in Figure 1) deformed and disarranged, limiting the motion of the magnetic plunger. This prevented the generator from functioning. No facilities were available for breaking down the recovered dud at this activity. Therefore no examination of the internal damage could be made. However, since the external damage was similar to that on the fuzes subjected to drop tests it may be assumed that the internal damage was also similar.



CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

-----

PART D

CONCLUSIONS

11. The following conclusions are based upon the limited number of rounds fired during this test.

a. The T-2025 fuzes tested were not sensitive enough to function on less than 1/4" thick 24ST aluminum targets set at 0° obliquity, at striking velocities of 2000 ft/sec.

b. One of 3 rounds, fired at 0° 250 inch thick 24ST aluminum targets set at 0° obliquity, detonated high order. The delay was less than 6 inches. Average rocket striking velocities were 1800 ft/sec.

c. Two of 4 rounds fired at 0° 5 thick 24ST aluminum plate set at 0° obliquity detonated high order. One with a delay of less than 6 inches and the other less than 2 ft. Average rocket striking velocities were 1800 ft/sec.

CONFIDENTIAL  
SECURITY INFORMATION



CONFIDENTIAL

NPG REPORT NO. 1023


Functioning Test of P.D. Rocket Fuzo T-2025  
-----

The tests upon which this report is based were conducted by:  
R. T. CROWELL, Firing Director, Rocket Battery  
Terminal Ballistics Department

This report was prepared by:  
R. T. CROWELL, Firing Director, Rocket Battery  
Terminal Ballistics Department

This report was reviewed by:  
F. W. KASDORF, Head of Rocket Battery Division  
Terminal Ballistics Department  
E. LEVSTIK, Lieutenant Commander, USNR  
Terminal Ballistics Batteries Officer  
Terminal Ballistics Department  
W. B. ROBERTSON, Lieutenant Commander, USN  
Terminal Ballistics Officer  
Terminal Ballistics Department  
C. C. BRAMBLE, Director of Research  
Ordnance Group

APPROVED: J. F. BYRNE  
Captain, USN  
Commander, Naval Proving Ground

  
E. A. RUCKNER  
Captain, USN  
Ordnance Officer  
By direction

CONFIDENTIAL  
SECURITY INFORMATION

**CONFIDENTIAL**

**NPG REPORT NO. 1023**

**U. S. NAVAL PROVING GROUND  
DAHLGREN, VIRGINIA**

**First Partial Report**

**on**

**Army R&D Aircraft Rocket Fuzes**

-----  
**Final Report**

**on**

**Functioning Test of P.D. Rocket Fuze T-2025**

**Project No.: Chief of Ordnance TAl-2704**  
**Copy No.: 35**  
**No. of Pages: 8**

**Date:**

**CONFIDENTIAL  
SECURITY INFORMATION**

CONFIDENTIAL

Functioning Test of P.D. Rocket Fuze T-2025

NPG REPORT NO. 1023

TABLE I

FUNCTIONING TEST OF POINT DETONATING FUZE T-2025TABLE OF TEST RESULTS

| Rd. No. | Fuze No. | Obliquity | Target Thickness | Target Material | Velocities |           | Propelled by      |                 | Head Loading | Time of Flight | Functioning | Explosive Delay            |
|---------|----------|-----------|------------------|-----------------|------------|-----------|-------------------|-----------------|--------------|----------------|-------------|----------------------------|
|         |          |           |                  |                 | Desired    | Obtained  | (a) 5" Head Motor | (b) 5" Pusher " |              |                |             |                            |
| 1       | 13       | 0°        | 08500            | 24ST Alum.      | 2000       | 1862      | (b) HVAR          | (b) HVAR        | (Black)      | -              | HD          | Not greater than 24 inches |
| 2       | 18       | 0°        | 08032            | "               | "          | 2075      | (a) Model 38      | (a) Model 38    | (Powder)     | -              | HD          | -                          |
| 3       | 16       | 0°        | 08064            | "               | "          | 2169      | (b) HVAR          | (b) HVAR        | "            | 1.3            | Dud         | -                          |
| 4       | 12       | 0°        | 08125            | "               | "          | est. 2200 | (a) Model 38      | (a) Model 38    | "            | 0.99           | Dud         | -                          |
| 5       | 7        | 0°        | 08250            | "               | "          | est. 1800 | (a) Model 38      | (a) Model 38    | HE           | 0.95           | Dud         | -                          |
| 6       | 9        | 0°        | 08250            | "               | "          | 1487      | (a) HVAR          | (a) HVAR        | HE           | 1.2            | High Order  | Less than 6 inches         |
| 7       | 3        | 0°        | 08250            | "               | "          | 1801      | (a) HVAR          | (a) HVAR        | HE           | 1.5            | Dud         | -                          |
| 8       | 11       | 0°        | 0850             | "               | "          | 1822      | (a) HVAR          | (a) HVAR        | HE           | 1.12           | Dud         | -                          |
| 9       | 6        | 0°        | 0850             | "               | "          | 1738      | (a) HVAR          | (a) HVAR        | HE           | -              | Dud         | -                          |
| 10      | 10       | 0°        | 0850             | "               | "          | est. 1900 | (a) HVAR          | (a) HVAR        | HE           | 1.14           | High Order  | Less than 6 inches         |
| 11      | 19       | 45°       | 08064            | "               | "          | 1976      | (a) HVAR          | (a) HVAR        | HE           | 1.3            | Dud         | -                          |
|         |          |           |                  |                 |            |           |                   |                 | HE           | .99            | Dud         | -                          |

CONFIDENTIAL  
SECURITY INFORMATION

APPENDIX A

JP9-49332

16 April 1952

Functioning Test of Point Detonating Fuze T-2025 Photograph of Magnavox Drawing No. 197695.  
Figure 1

CONFIDENTIAL  
SECURITY INFORMATION



MP9-49333

16 April 1952

Functioning Test of Joint Detonating Fuze T2025 Photograph of Magnavox Company Drawing  
No. 19Y797.

CONFIDENTIAL  
SECURITY INFORMATION

CONFIDENTIAL

ARMED ARMING  
SPRING  
POTENTIAL  
CEMENT  
FROM  
PUMP  
CAUTION

CONFIDENTIAL

ARMING ARRANGEMENT

SECRET

|    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |     |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |     |  |
|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|-----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|----|--|-----|--|
| 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91 |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |     |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  | 10 |  | 11 |  | 12 |  | 13 |  | 14 |  | 15 |  | 16 |  | 17 |  | 18 |  | 19 |  | 20 |  | 21 |  | 22 |  | 23 |  | 24 |  | 25 |  | 26 |  | 27 |  | 28 |  | 29 |  | 30 |  | 31 |  | 32 |  | 33 |  | 34 |  | 35 |  | 36 |  | 37 |  | 38 |  | 39 |  | 40 |  | 41 |  | 42 |  | 43 |  | 44 |  | 45 |  | 46 |  | 47 |  | 48 |  | 49 |  | 50 |  | 51 |  | 52 |  | 53 |  | 54 |  | 55 |  | 56 |  | 57 |  | 58 |  | 59 |  | 60 |  | 61 |  | 62 |  | 63 |  | 64 |  | 65 |  | 66 |  | 67 |  | 68 |  | 69 |  | 70 |  | 71 |  | 72 |  | 73 |  | 74 |  | 75 |  | 76 |  | 77 |  | 78 |  | 79 |  | 80 |  | 81 |  | 82 |  | 83 |  | 84 |  | 85 |  | 86 |  | 87 |  | 88 |  | 89 |  | 90 |  | 91  |  | 92 |  | 93 |  | 94 |  | 95 |  | 96 |  | 97 |  | 98 |  | 99 |  | 100 |  |
| 1  |  | 2  |  | 3  |  | 4  |  | 5  |  | 6  |  | 7  |  | 8  |  | 9  |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |     |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |    |  |     |  |



NP9-49334

Functioning Test of Point Detonating Fuze T2025 and after assembly.

18 April 1952

CONFIDENTIAL  
SECURITY INFORMATION

Photograph of Experimental round before  
Figure 3

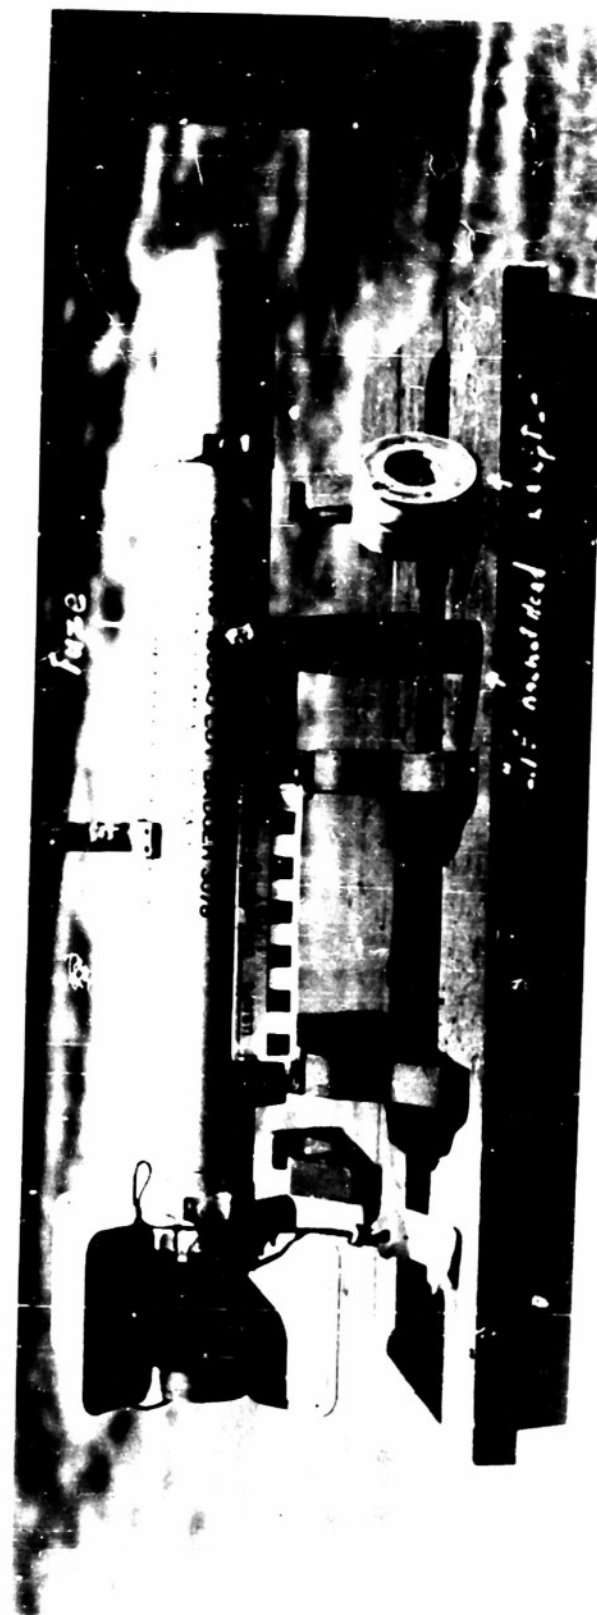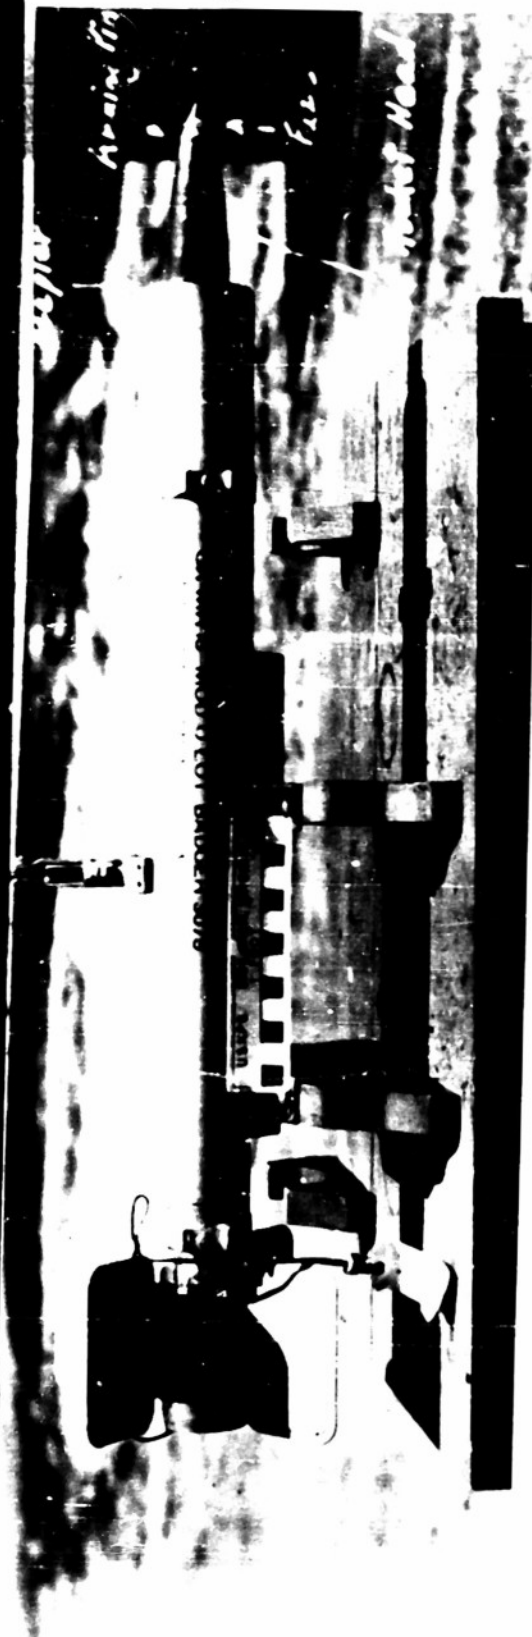

35

Functioning Test of Point Detonating Fuze T-2025. View of target during rocket penetra-  
tion. Camera 16mm Eastman - frame rate est 3000 fps. Fired from 1050 ft. launcher.  
2:75 Rocket Head (Smoke Puff Loaded).

|      |     |        |      |          |             |                                                 |
|------|-----|--------|------|----------|-------------|-------------------------------------------------|
| Fig. | Rd. | Target |      | Striking |             | Remarks                                         |
| No.  | No. | 0"500  | 245" | Alum.    | Velocity    | Explosive delay less than 2 ft.                 |
| 1    | 1   | 0°     | 0°   | "        | 1862 ft/sec | Note: (1) Plate flash                           |
| 2    | 2   | 0°032  | "    | "        | 2075 "      | (2) Intact condition of head after penetration. |

Figure 4

Figure 5






NP9-49336

CONFIDENTIAL & SECURITY INFORMATION  
 Functioning Test of Point Detonating Fuze T-2025. View of target during rocket penetra-  
 tion. Camera 16mm Eastman - frame rate est 3000 fps. Fired from 1050 ft. launcher in  
 2"75 Rocket Head. Rd. 3 Smoke Puff Loaded. Rd. 5 High Explosive Loaded.

| No. | Rd. | Target           | Obt. | Striking    | Velocity | Func. | Remarks                            |
|-----|-----|------------------|------|-------------|----------|-------|------------------------------------|
| 6   | 3   | 0"064 24ST Alum. | 0°   | 2169 ft/sec | Dud      |       | Plate flash, no head detonation.   |
| 7   | 5   | 0"25 24ST Alum.  | 0°   | 1800 ft/sec | H0       |       | Delay in functioning less than 6". |

Figure 6

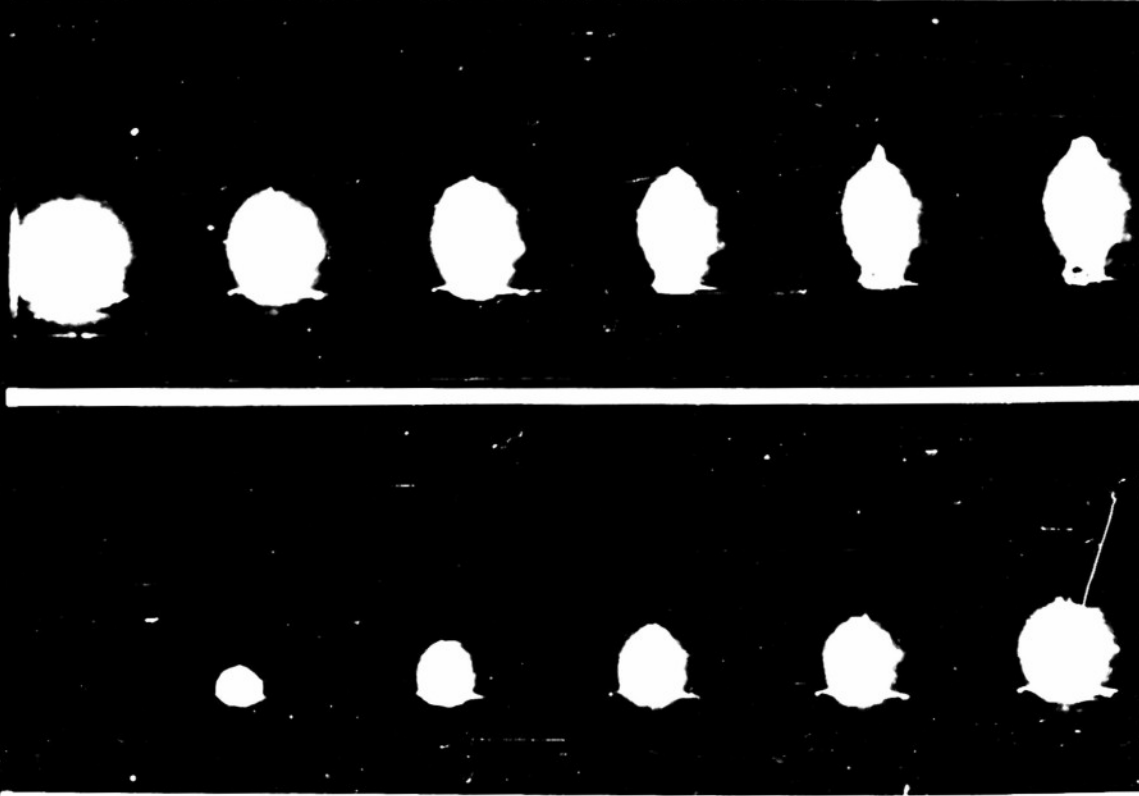

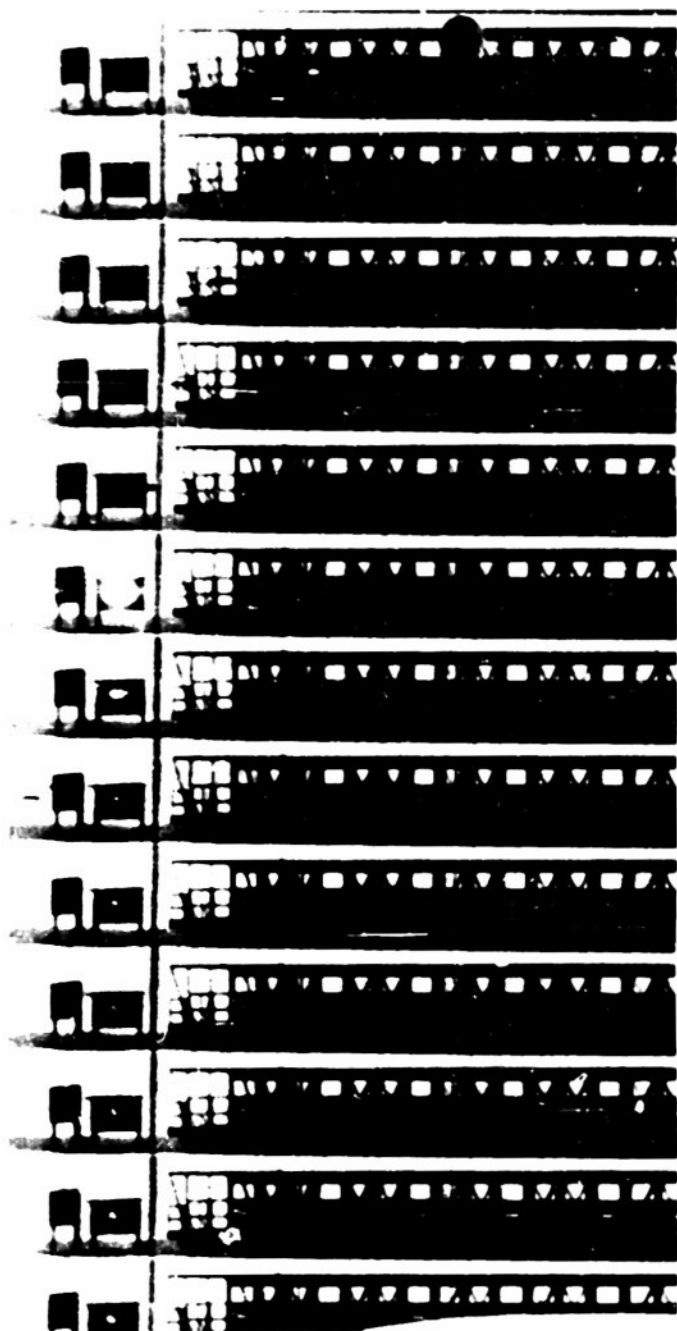


Figure 8

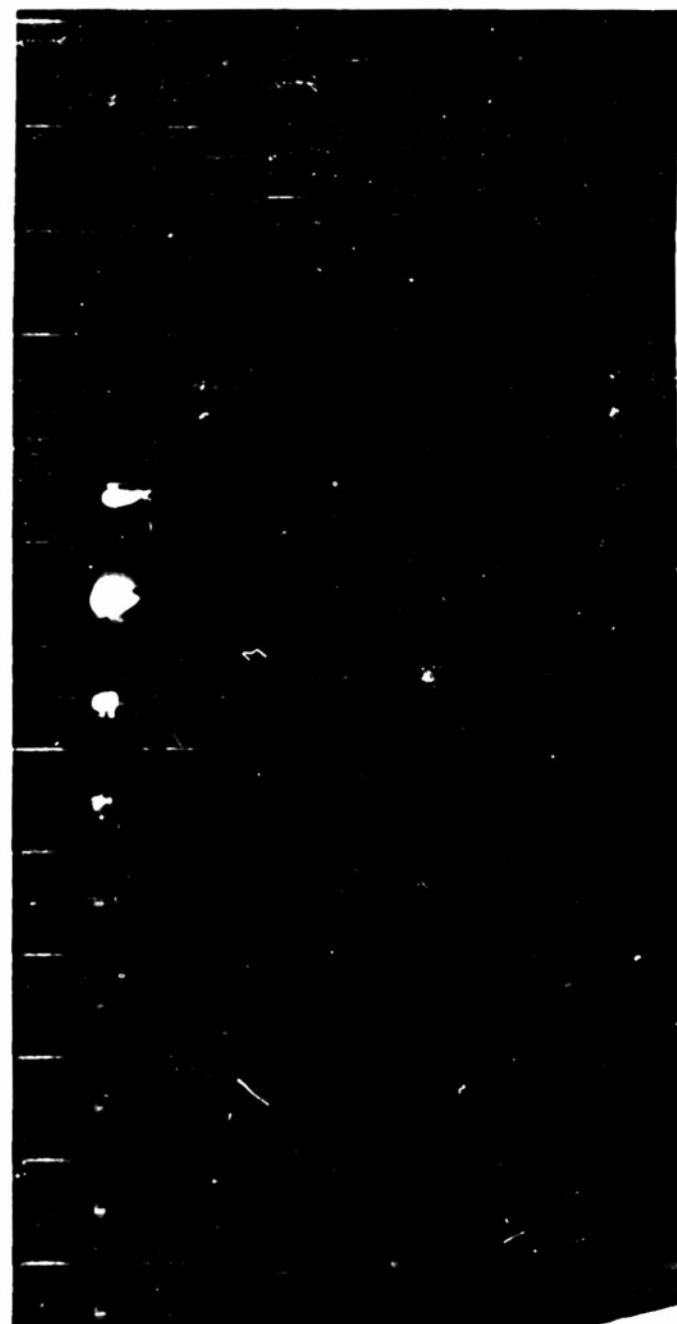


Figure 9

NP9-49337 12 April 1952 CONFIDENTIAL - SECURITY INFORMATION  
 Functioning Test of Point Detonating Fuze T-2025. View of target during  
 rocket penetration. Camera Bowen - frame rate 90 fps.  
 Fig. Rd. Target Striking  
 No. No. Thickness Obl. Velocity Func. Remarks  
 6 2 0.25 24ST Alum. C° 1487 Dud Plate flash is seen  
 and not head  
 detonation

AF-47330

CONFIDENTIAL - SECURITY INFORMATION  
 Functioning Test of Point Detonating Fuze T-2025. View of target during rocket penetration.

Fig. Rd.

No. 10

Target

0:50 24ST Alum.

Obt.

C

Striking

Velocity

1320 ft/sec

Func.

Dud


1738 ft/sec

H0

Remarks

Plate flash is seen and not head detonation.  
 Note: (1) Explosive delay estimated at less than 6". (2) Note plate fragments.

Figure 10

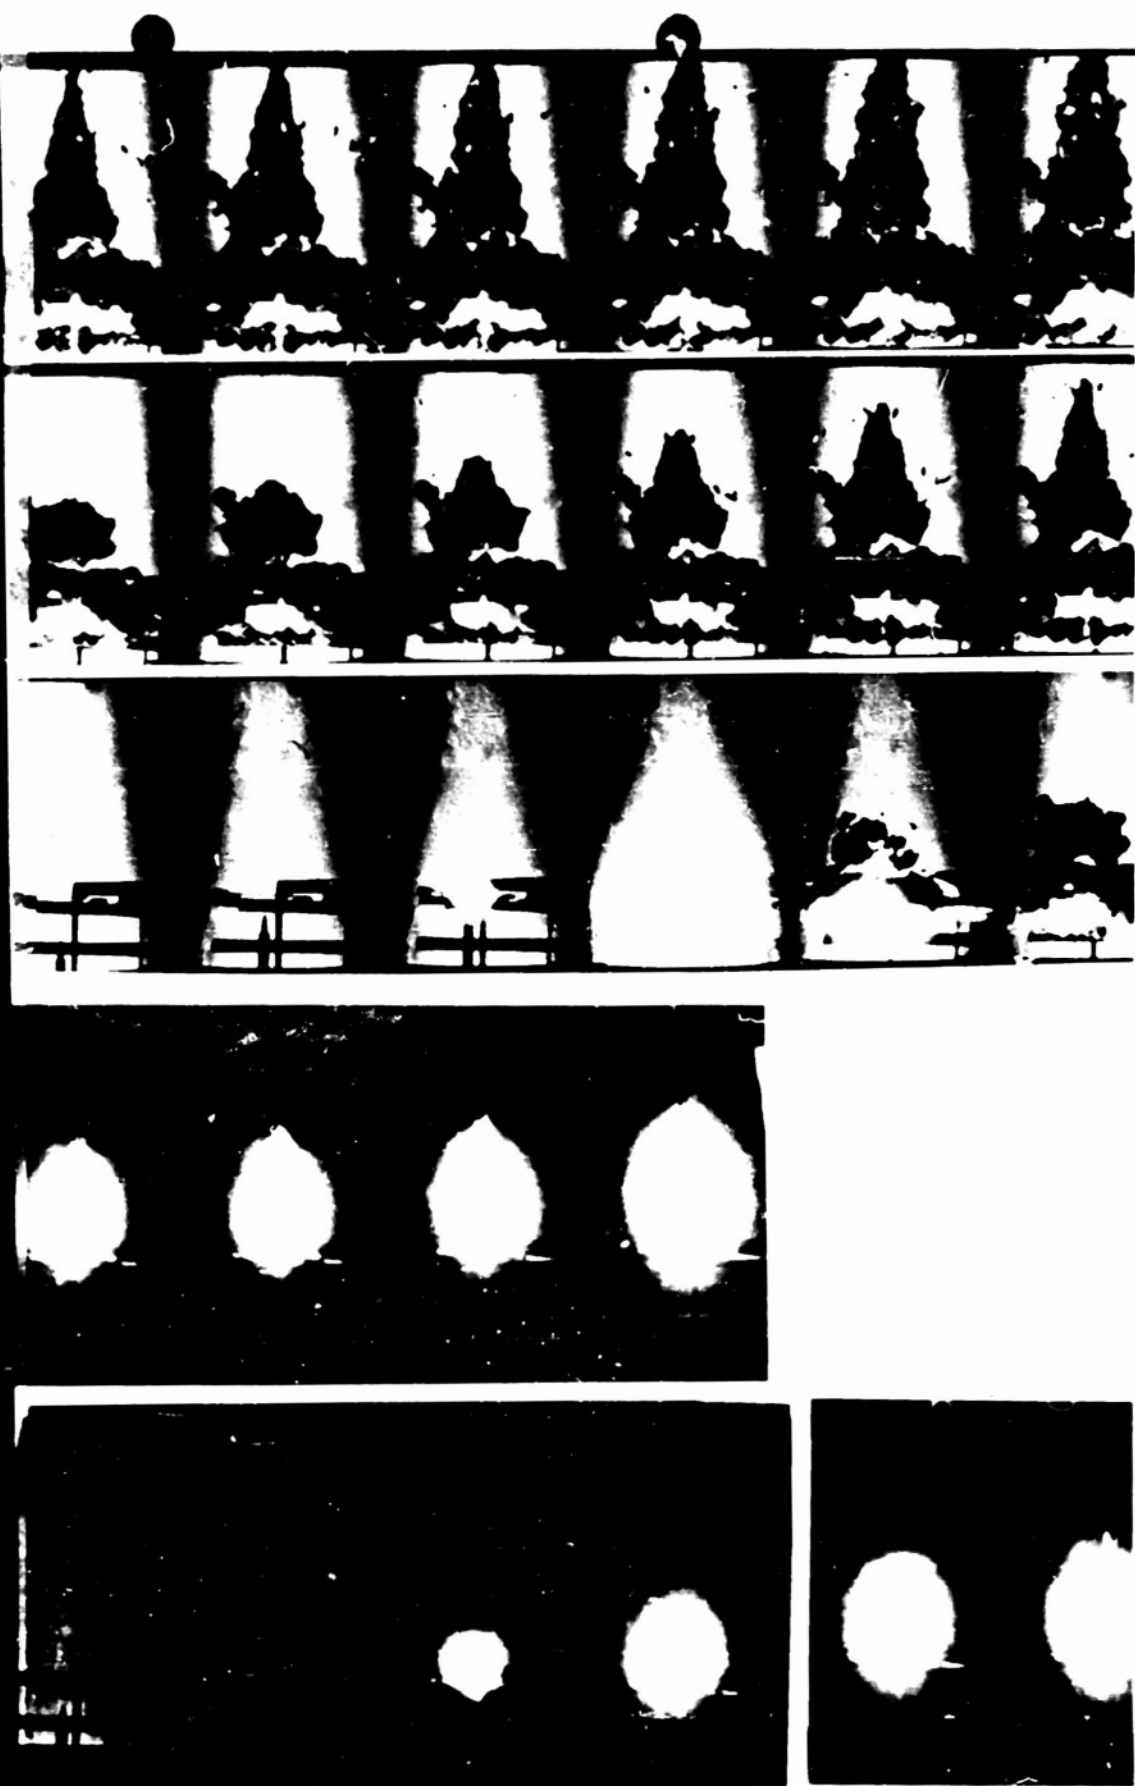


CONFIDENTIAL  
SECURITY INFORMATION

NP9-49339  
Functioning Test of Point Detonating Fuze T-2025 on face of 1/2" 24ST Aluminum Plate. Photograph of 1/2" (24ST Aluminum Target) showing Impact of round 9 with High Order detonation marks on the face of the target. Striking Velocity 1738 ft/sec. Target was set normal to the line of fire.





76

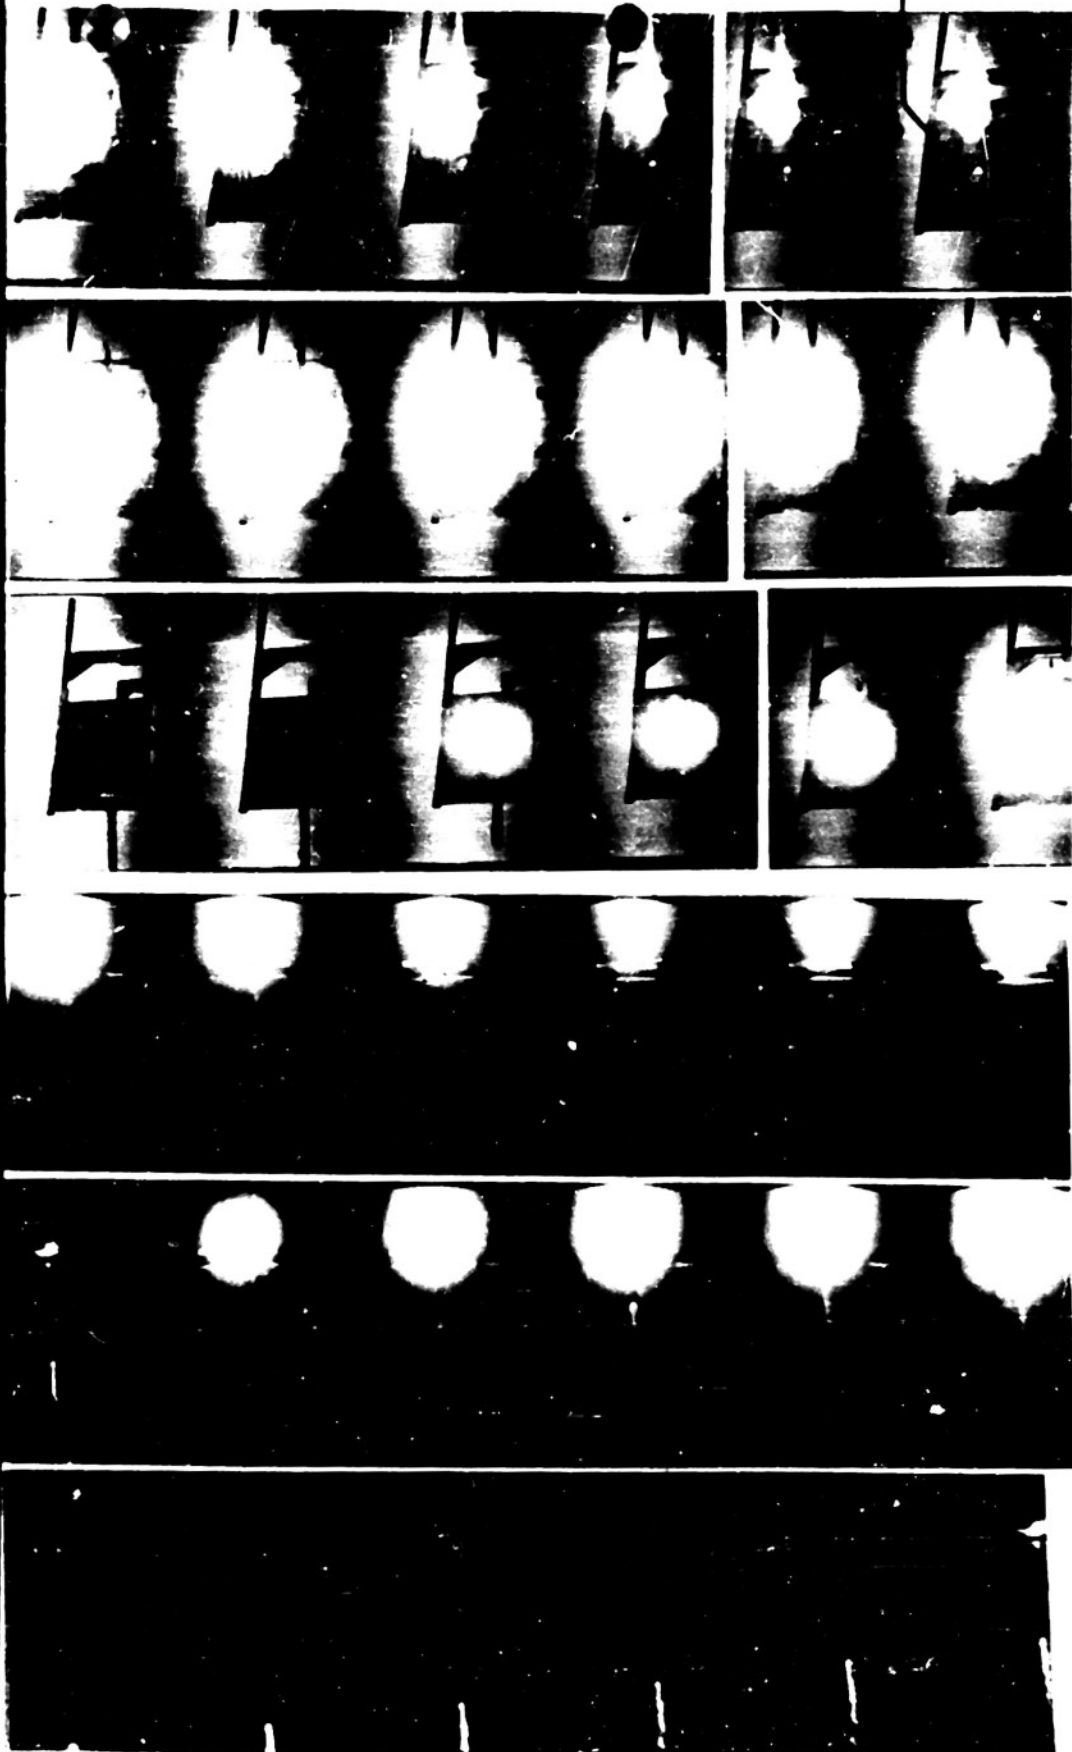

NP9-49341

Functioning Test of Point Detonating Fuze T-2025. Photograph of recovered dud.

|     |      |         |          |                   |          |
|-----|------|---------|----------|-------------------|----------|
| Rd. | Fuze | Date    | Striking | Target            | Function |
| No. | No.  | Fired   | Velocity |                   | Dud      |
| 10  | 10   | 4-18-52 | est 1900 | 1/2" (24ST Alum.) |          |

Note: (1) Base torn off.

(2) Point of fuze punctured.

Figure 15



CONFIDENTIAL

NPG REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025

DISTRIBUTION

Bureau of Ordnance

|                                                                                                                                                 |   |
|-------------------------------------------------------------------------------------------------------------------------------------------------|---|
| Ad3                                                                                                                                             | 1 |
| Re2                                                                                                                                             | 1 |
| Re2b                                                                                                                                            | 1 |
| Chief of Ordnance,<br>Department of the Army<br>Attn: CRDTX-AR                                                                                  | 2 |
| ORDESB-TE2                                                                                                                                      | 1 |
| ORDTA                                                                                                                                           | 1 |
| Commanding General,<br>Aberdeen Proving Ground,<br>Aberdeen, Maryland<br>Attn: Technical Information Section,<br>Development and Proof Services | 1 |
| Commander, Operational Development Force<br>U. S. Atlantic Fleet, U. S. Naval Base,<br>Norfolk 11, Virginia                                     | 1 |
| Navy Research Section,<br>Library of Congress,<br>Washington 25, D. C.,<br>(via Re2b)                                                           | 2 |
| Chief of Ordnance,<br>Department of the Army,<br>Attn: ORDTQ                                                                                    | 1 |
| BUAER<br>Attn: Armament Section                                                                                                                 | 2 |
| Air Material Command Liaison Officer,<br>Wing 3 Headquarters, Aberdeen Proving Ground,<br>Aberdeen, Maryland                                    | 2 |
| Naval Liaison Officer,<br>USAFPGC, Eglin Field, Florida                                                                                         | 1 |

CONFIDENTIAL  
SECURITY INFORMATION

CONFIDENTIAL

NPC REPORT NO. 1023

Functioning Test of P.D. Rocket Fuze T-2025  
-----

DISTRIBUTION (Continued)

|                                                                                                                           |        |
|---------------------------------------------------------------------------------------------------------------------------|--------|
| U. S. Air Force,<br>AMC Engineering Field Office,<br>Room 1833, Main Navy Building,<br>Navy Department, Washington, D. C. | 2      |
| Commander, Naval Ordnance Laboratory,<br>White Oak, Silver Spring, Maryland<br>Attn: Library<br>(DP Section)              | 2<br>3 |
| Commanding Officer,<br>Picatinny Arsenal,<br>Dover, New Jersey<br>Attn: ORDES-T                                           | 2      |
| Commanding General<br>Air Material Armament Test Center<br>Eglin Air Force Base, Florida                                  | 1      |
| Local:                                                                                                                    |        |
| OT                                                                                                                        | 1      |
| CV                                                                                                                        | 1      |
| File                                                                                                                      | 1      |

CONFIDENTIAL  
SECURITY INFORMATION